

Il nuovo codice sarà fornito solo ad esaurimento del vecchio

The new code will be supplied only when the old will be out of stock

Der neue Kode wird nur angegeben, wenn der alte nicht mehr lieferbar ist

Le nouveau code sera fourni uniquement lorsque le vieux stock sera écoulé

El nuevo código será suministrado sólo cuando se agoten las existencias del antiguo

O novo código irá ser fornecido apenas quando o antigo esgotar stock

easu MANIFOLD p. 247

* $F_{1i} =$

Isothermal end force at 100% Cu p. 16

** $F_{1p} =$

Polytrophic end force at 100% Cu



ACTIVE SAFETY



OSAS



USAS





OPAS



SKUDO

CODE	Cu		L		L min		F ₀		F _{1i} *		F _{1p} **		V ₀		Maintenance kit		
	mm	inch	mm	inch	mm	inch	daN	lb	daN	lb	daN	lb	cm ³	in ³	~Kg	~lb	
KE 12000 - 010 - B	10	0.39	100	3.94	90	3.54	11780	26482	17843	40113	21398	48104	267	16.28	5,49	12.10	✓
KE 12000 - 016 - B	16	0.63	126	4.96	110	4.33			17646	39670	21084	47399	437	26.64	6,11	13.47	✓
KE 12000 - 025 - B	25	0.98	155	6.10	130	5.12	150 bar	2175psi	18657	41943	22704	51040	613	37.39	6,76	14.90	✓
KE 12000 - 032 - B	32	1.26	187	7.36	155	6.10			18166	40838	21913	49261	824	50.28	7,54	16.62	✓
KE 12000 - 040 - B	40	1.57	220	8.66	180	7.09	+ 20 °C	+ 68 °F	18098	40687	21805	49020	1037	63.30	8,31	18.32	✓
KE 12000 - 050 - B	50	1.97	260	10.24	210	8.27			18116	40727	21834	49084	1294	78.97	9,25	20.9	✓
KE 12000 - 065 - B	65	2.56	320	12.60	255	10.04	18133	40764	21860	49143	1679	102.48	10,66	23.50	✓		

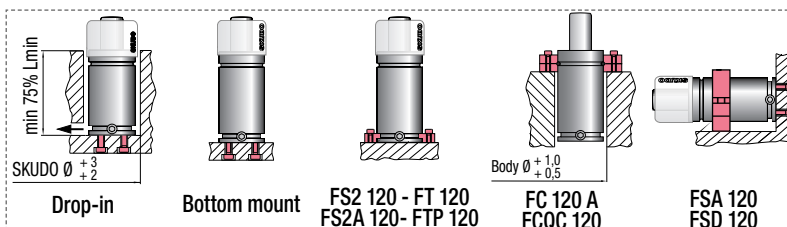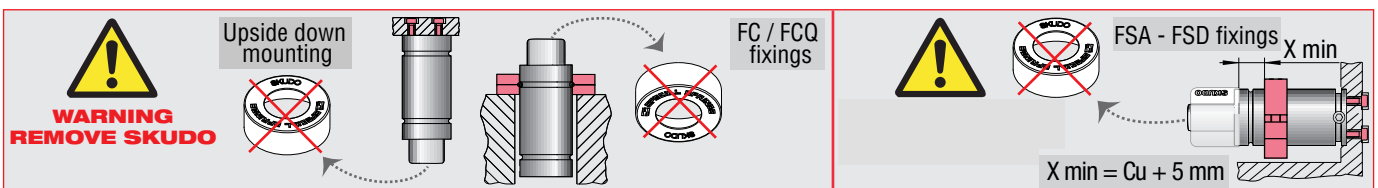

HOW TO ORDER

p. 195

INSTALLATION GUIDELINE

p. 205